



**American
Flamecoat
Inc.**

520 Eagleton Downs Drive, Suite D
Pineville, NC 28134
704-405-2550
justin@americanflamecoat.com
www.americanflamecoat.net

Client: Lori Weitzner Design
54 W. 21st Street
New York, NY 10011

Test Report No: 123152

Date: 12-31-2015

The Following sample was submitted by the client as: W1069 Headlines

DATE OF RECEIPT: 12-15-2015

TESTING PERIOD: 12-21-2015

TEST REQUESTED: The submitted sample was tested for flammability in accordance with the procedures outlined in ASTM E-84-98.

SIGNED





American Flamecoat Inc.

520 Eagleton Downs Drive, Suite D
Pineville, NC 28134
704-405-2550
brad@americanflamecoat.com
www.americanflamecoat.com

INTRODUCTION:

This report presents test results of Flame Spread and Smoke Developed Value per ASTM E-84-98. The report also includes Material Identification, Method of Preparation, Mounting and Conditioning of the specimens.

The test were performed in accordance with the specifications set forth in ASTM E-84-98, Standard Test Method for Surface Burning Characteristics of Building Materials, both as to equipment and test procedures. This test procedure is similar to UL-723, ANSI NO. 2.5, NFPA No. 255 and UBC 42-1.

The test results cover two parameters: Flame Spread and Smoke Developed Values during the 10-minute fire exposure. Inorganic cement board and red oak flooring are used as comparative standards and their responses are assigned arbitrary values of 0 and 100 respectively.

PREPARATION AND CONDITIONING: TREATED WITH FLAMECOAT

Shur-stik III Vinyl Wallcovering Adhesive was applied to three (3) 2-foot x 8-foot sections of IC board. The sample was placed over the adhesive and allowed to cure.

The sample was conditioned at 73 +/- 5 Fahrenheit and 50 +/- relative humidity.

TEST PROCEDURE:

The tunnel was thoroughly pre-heated by burning natural gas. When the brick temperature, sensed by a floor thermocouple, had reached the prescribed 105 Fahrenheit +/- 5 Fahrenheit level, the sample was inserted in the tunnel at test conducted in accordance with the standard ASTM E-84-98 procedures.

The operation of the tunnel was checked by performing a 10-minute test with inorganic board the day of the test.



American Flamecoat Inc.

520 Eagleton Downs Drive, Suite D
Pineville, NC 28134
704-405-2550
justin@americanflamecoat.com
www.americanflamecoat.net

TEST RESULTS:

The test results, calculated in accordance with ASTM E-84-98 for Flame Spread and Smoke Developed Values are as follows:

Test Specimen: W1069 Headlines
Flame Index* 15
Smoke Developed Value* 205

Observation: The Tested Fabric Meets the Requirements for ASTM E-84

Rating: Class A


The National Fire Protection Association Life Safety Code 101, Section 6-5.3, "Interior Wall and Ceiling Finish Classification", has a means of classifying materials with respect to Flame Spread and Smoke Developed when tested in accordance with NFPA 255, "Method of Test of Surface Burning Characteristics of Building Materials", (ASTM E-84)

The classifications are as follows:


| | | |
|---|------------------|--------|
| Class A Interior Wall & Ceiling Finish: | Flame Spread- | 0-25 |
| | Smoke Developed- | 0-450 |
| Class B Interior Wall & Ceiling Finish: | Flame Spread- | 26-75 |
| | Smoke Developed- | 0-450 |
| Class C Interior Wall & Ceiling Finish: | Flame Spread- | 76-200 |
| | Smoke Developed- | 0-450 |

Client: Weitzner
Report #: 123152
Sample: W1069 Headlines

Smoke Developed:

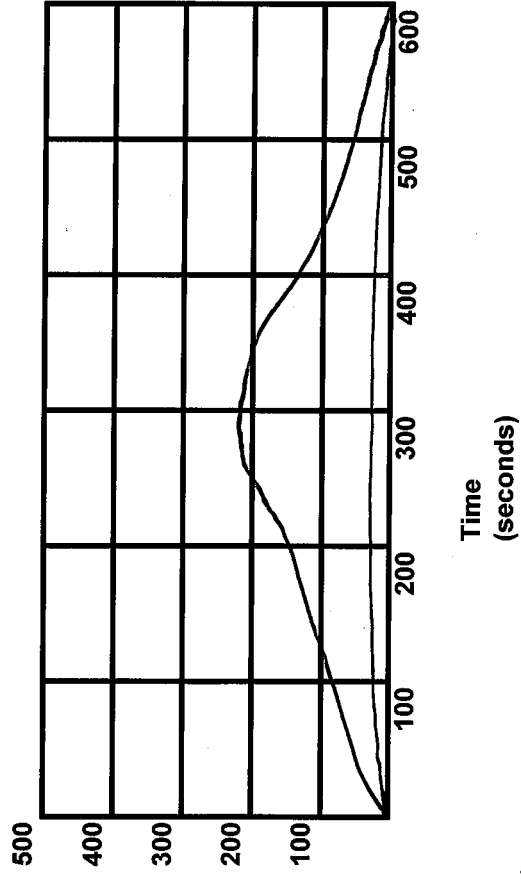

Client: Weitzner
Report #: 123152
Sample: W1069 Headlines

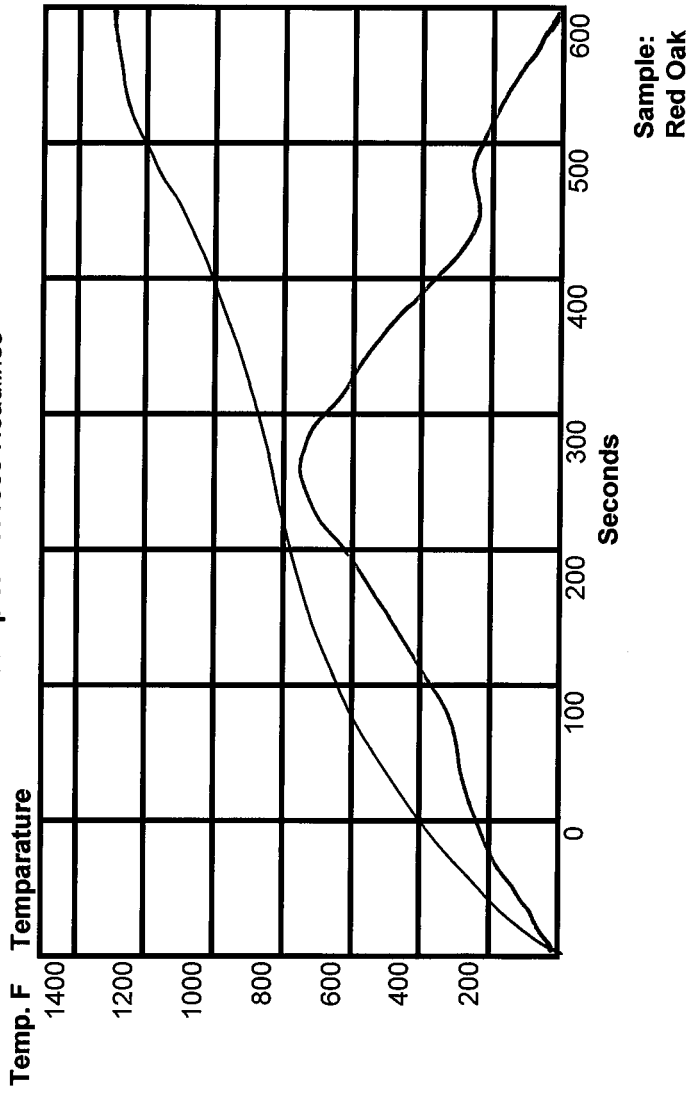

Client: Weitzner
Report #: 123152
Sample: W1069 Headlines

