



**American  
Flamecoat  
Testing**

520 Eagleton Downs Dr.  
Suite D  
Pineville, NC 28134  
704-543-0903

Client: Lori Weitzner Design  
54 W. 21<sup>st</sup> Street  
New York, NY 10011

Test Report No: 410131

Date: 4-11-2013

The Following sample was submitted by the client as: W1027 Aria

DATE OF RECEIPT: 4-08-2013

TESTING PERIOD: 4-10-2013

TEST REQUESTED: The submitted sample was tested for flammability in accordance with the procedures outlined in ASTM E-84-98.

SIGNED



# American Flamecoat Testing

520 Eagleton Downs Dr.  
Suite D  
Pineville, NC 28134  
704-543-0903

Lori Weitzner Design  
54 W. 21<sup>st</sup> Street  
New York, NY 10011

410131  
Date: 4-11-2013

## **INTRODUCTION:**

This report presents test results of Flame Spread and Smoke Developed Value per ASTM E-84-98. The report also includes Material Identification, Method of Preparation, Mounting and Conditioning of the specimens.

The test were performed in accordance with the specifications set forth in ASTM E-84-98, Standard Test Method for Surface Burning Characteristics of Building Materials, both as to equipment and test procedures. This test procedure is similar to UL-723, ANSI NO. 2.5, NFPA No. 255 and UBC 42-1.

The test results cover two parameters: Flame Spread and Smoke Developed Values during the 10-minute fire exposure. Inorganic cement board and red oak flooring are used as comparative standards and their responses are assigned arbitrary values of 0 and 100 respectively.

## **PREPARATION AND CONDITIONING:**

Shur-stik III Vinyl Wallcovering Adhesive was applied to three (3) 2-feet x 8-feet sections of IC board. The sample was placed over the adhesive and allowed to cure.

The sample was conditioned at 73 +/- 5 Fahrenheit and 50 +/- relative humidity.

## **TEST PROCEDURE: Adhered**

The tunnel was thoroughly pre-heated by burning natural gas. When the brick temperature, sensed by a floor thermocouple, had reached the prescribed 105 Fahrenheit +/- 5 Fahrenheit level, the sample was inserted in the tunnel at test conducted in accordance with the standard ASTM E-84-98 procedures.

The operation of the tunnel was checked by performing a 10-minute test with inorganic board the day of the test.



# American Flamecoat Testing

520 Eagleton Downs Dr.  
Suite D  
Pineville, NC 28134  
704-543-0903

Lori Weitzner Design  
54 W. 21<sup>st</sup> Street  
New York, NY 10011

410131  
Date: 4-11-2013

## **TEST RESULTS:**

The test results, calculated in accordance with ASTM E-84-98 for Flame Spread and Smoke Developed Values are as follows:

Test Specimen: W1027 Aria  
Flame Index\* 10  
Smoke Developed Value\* 135

**Observation: The Tested Fabric Meets the Requirements for ASTM E-84**

## **Rating: Class A**


The National Fire Protection Association Life Safety Code 101, Section 6-5.3, "Interior Wall and Ceiling Finish Classification", has a means of classifying materials with respect to Flame Spread and Smoke Developed when tested in accordance with NFPA 255, "Method of Test of Surface Burning Characteristics of Building Materials", (ASTM E-84)

The classifications are as follows:


Class A Interior Wall & Ceiling Finish:	Flame Spread-	0-25
	Smoke Developed-	0-450
Class B Interior Wall & Ceiling Finish:	Flame Spread-	26-75
	Smoke Developed-	0-450
Class C Interior Wall & Ceiling Finish:	Flame Spread-	76-200
	Smoke Developed-	0-450

Smoke Developed:

Client: Lori Weltzner  
Report #: 410131  
Sample: W1027 Aria

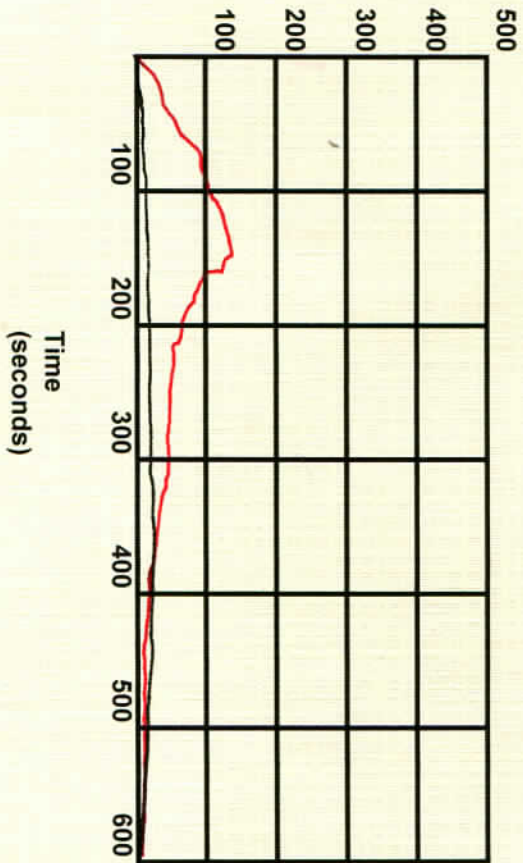

Client: Lori Weitzner  
Report #: 410131  
Sample: W1027 Aria

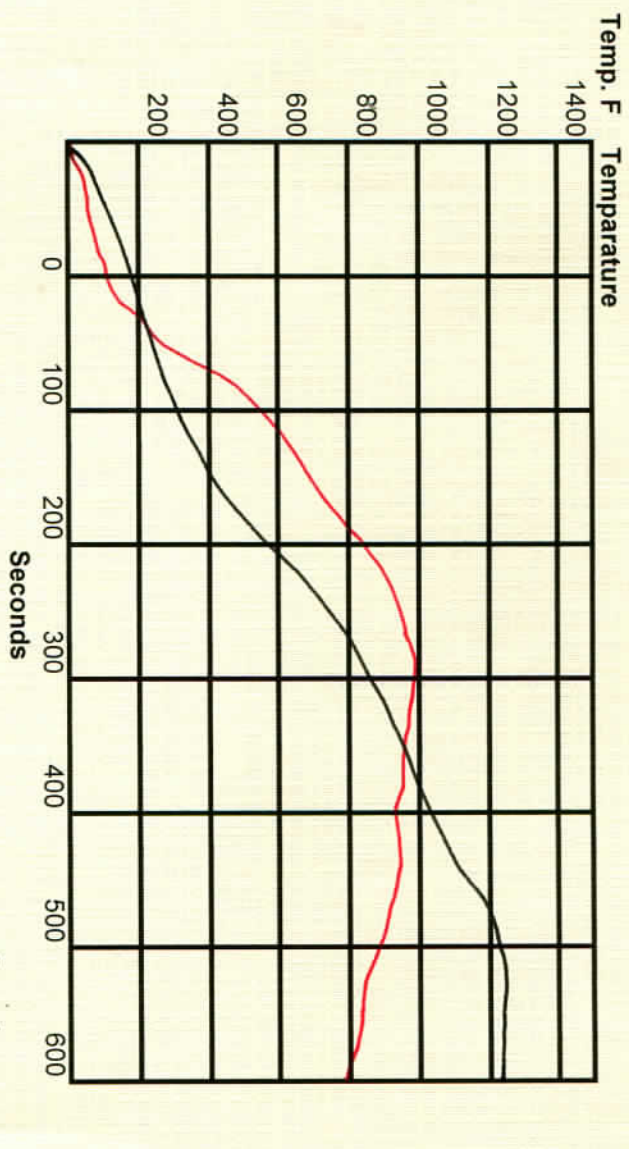

Sample: — (red line)  
Red Oak — (black line)

Client: Lori Weizner  
Report #: 410131  
Sample: W1027 Aria

Flame Spread

